


Fresa testa sferica in metallo duro integrale

Solid carbide ball nose end mill



VHM - Radiusfräser - Fraise carbure à bout hémisphérique

Фреза концевая твердосплавная полусферическая - Sk kulová fréza

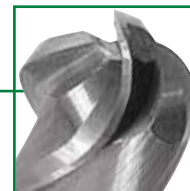

CODE UNCOATED	CODE HYPER	*d1 mm	d2h6 mm	l1 mm	L mm	Z no.
400R.010G1	400RT.010G1	1	1	5	38	4
400R.010	400RT.010	1	3	2.5	40	4
400R.015G15	400RT.015G15	1.5	1.5	5	38	4
400R.015	400RT.015	1.5	3	4	40	4
400R.020G2	400RT.020G2	2	2	8	38	4
400R.020	400RT.020	2	3	5	40	4
400R.025G25	400RT.025G25	2.5	2.5	8	38	4
400R.025	400RT.025	2.5	3	7	40	4
400R.030	400RT.030	3	3	12	40	4
400RL.030	400RLT.030	3	3	30	60	4
400RL.030.1	400RLT.030.1	3	3	30	75	4
400R.040	400RT.040	4	4	16	50	4
400RL.040	400RLT.040	4	4	30	60	4
400RL.040.1	400RLT.040.1	4	4	30	75	4
400R.045	400RT.045	4.5	4.5	16	50	4
400R.050	400RT.050	5	5	20	50	4
400RL.050	400RLT.050	5	5	35	70	4
400RL.050.1	400RLT.050.1	5	5	40	100	4
400R.055	400RT.055	5.5	5.5	20	50	4
400R.060	400RT.060	6	6	20	50	4
400RL.060	400RLT.060	6	6	40	100	4
400RL.060.1	400RLT.060.1	6	6	50	150	4
400R.070	400RT.070	7	7	22	60	4
400R.080	400RT.080	8	8	22	60	4
400RL.080	400RLT.080	8	8	40	100	4
400RL.080.1	400RLT.080.1	8	8	50	150	4
400R.090	400RT.090	9	9	22	70	4
400R.100	400RT.100	10	10	25	70	4
400RL.100	400RLT.100	10	10	45	100	4
400RL.100.1	400RLT.100.1	10	10	60	150	4
400R.110	400RT.110	11	11	27	75	4
400R.120	400RT.120	12	12	27	75	4
400RL.120	400RLT.120	12	12	45	100	4
400RL.120.1	400RLT.120.1	12	12	75	150	4
400R.130	400RT.130	13	13	27	75	4
400R.140	400RT.140	14	14	30	85	4
400RL.140	400RLT.140	14	14	45	100	4
400RL.140.1	400RLT.140.1	14	14	65	150	4
400RL.140.2	400RLT.140.2	14	14	75	150	4
400R.150	400RT.150	15	15	30	85	4
400RL.150	400RLT.150	15	15	45	100	4
400R.160	400RT.160	16	16	30	85	4
400RL.160	400RLT.160	16	16	45	100	4
400RL.160.1	400RLT.160.1	16	16	65	150	4
400RL.160.2	400RLT.160.2	16	16	75	150	4
400R.180	400RT.180	18	18	40	100	4
400RL.180	400RLT.180	18	18	50	150	4
400RL.180.1	400RLT.180.1	18	18	65	150	4
400RL.180.2	400RLT.180.2	18	18	75	150	4
400R.200	400RT.200	20	20	40	100	4
400RL.200	400RLT.200	20	20	55	150	4
400RL.200.1	400RLT.200.1	20	20	65	150	4
400RL.200.2	400RLT.200.2	20	20	75	150	4
400R.250	400RT.250	25	25	40	100	4
400RL.250	400RLT.250	25	25	55	150	4
400RL.250.1	400RLT.250.1	25	25	75	150	4
400R.320	400RT.320	32	32	40	100	4
400RL.320	400RLT.320	32	32	75	150	4

→ Help 155-194

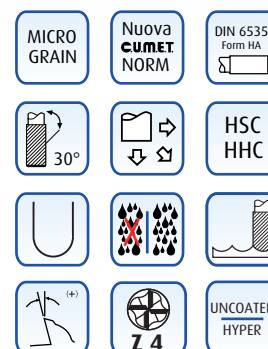

*d1 ≤ ø 6 h9
d1 ≤ ø32 f7